

FIBRE OPTIC FX STAR CEILING GENERAL INSTALLATION INSTRUCTIONS


TEL 01254 888809 FAX 01254 888909

STEP 1

Plug the fibre Head into the the lightsource and secure (A)
Access above the ceiling is required to insert the fibres
PLEASE NOTE The fibres should be fitted after the ceiling
has been painted

Drill appropriate quantity and size holes through ceiling
from below in a random pattern
Locate Light source in a convenient position for future
maintainance ensuring that the fibres will reach the
furthest point

Strip sheath as in ref 1 &2

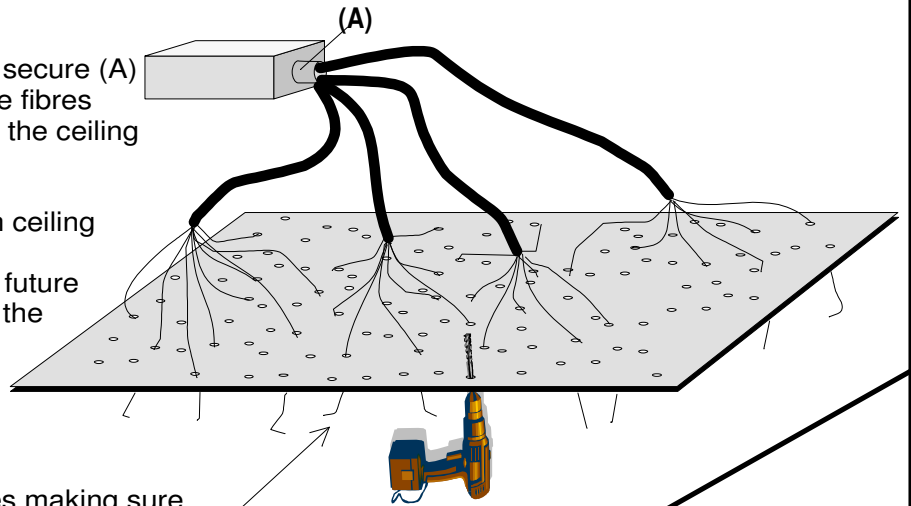


STEP 2

Push the excess of each fibre through the holes making sure
none are pulled too tight-cut them back to a convenient length
of about 200mm


ref 1 Set knife blade to 2mm slit pvc sheath along the required length
ensuring the blade does not scape and damage the fibres.

Alternatively if you have purchased a rotary stripper from FOFX attach
stripper as shown in the instructions rotate to radially to cut the sheath
and repeat the cut every 300 mm until desired length is stripped.

ref 2 Ensure all fibres are removed from the sheath
and then cut off the surplus pvc.

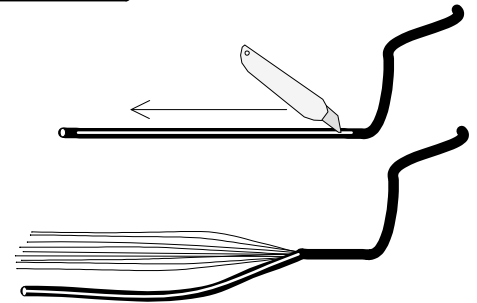

STEP 3

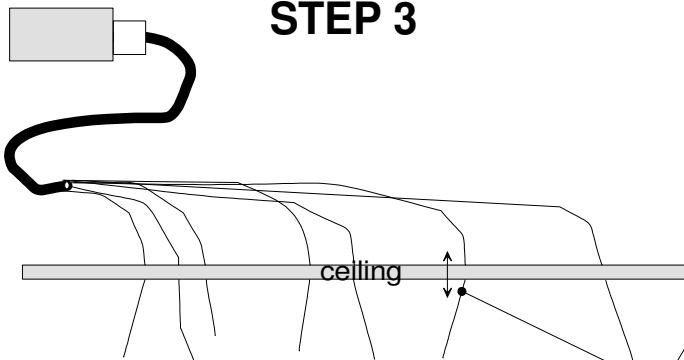

Apply a small amount of epoxy glue at this point, work the fibre up and down so as to line
the hole in the ceiling with glue and not have
any below ceiling level.

**IMPORTANT DO NOT USE SUPER GLUE or
ANY GLUE CONTAINING SOLVENTS** as this
will make the fibre brittle and break off

STEP 4

